## **Historic, Archive Document**

Do not assume content reflects current scientific knowledge, policies, or practices.



UNITED STATES DEPARTMENT OF AGRICULTURE
Bureau of Agricultural Engineering
S. H. McCrory, Chief

in cooperation with

THE UNIVERSITY OF IOWA

Department of Hydraulics

C. C. Villiams, Dean, College of Engineering

A Report Upon

THE FLOW OF FATER THROUGH RECTANGULAR NOTCHES

Ву

D. L. Yarnell, Senior Drainage Engineer

Iowa City, Iowa October, 1931.

The world of the party of the

#### A Report upon

The Flow of Water Through Rectangular Notches

D. L. Yarnell, Senior Drainage Engineer,
Bureau of Agricultural Engineering

Experiments made at the University of Icwa Hydraulic Laboratory for use in connection with the studies on soil erosion from agricultural lands

#### Introduction

This report presents the results of a series of experiments on the flow of water through rectangular notches in metal plates which were conducted for the purpose of calibrating such devices for use in connection with the measurement of the amount of run-off from agricultural lands and the amount of silt washed from the surface of the ground. The experiments were conducted by the Bureau of Agricultural Engineering,

U. S. Department of Agriculture, and the State University of Iowa at the University hydraulic laboratory during August and September, 1931.

The report describes the construction of the apparatus, the method of making the tests and presents the experimental results.

The grant and the second of the other advantages of the second of the other and the second of the se

18 8 1 4 1 5 1 5 8 at 5 8

The state of the s

The state of the s

#### PURPOSE OF THE TESTS

In connection with the soil erosion investigations now being conducted by the U. S. Department of Agriculture, measurements are being made on the run-off from and the erosion on very small plots of ground, namely, one tenth and one one-hundredth of an acre. It is impractical to collect the entire amounts of runoff and eroded material from such tracts, hence a representative sample of the runoff and the eroded material must be obtained for each storm.

The soil erosion plots, located on sloping ground, are usually rectangular in shape, from 6 to 10 feet in width and 100 feet or more in length. Metal plates, 12 inches wide, are embedded on edge in the soil along the boundary of each plot so that the surface water must flow over the soil to the lower end of the tract. At this point the water passes into a metal box, in one end of which are located two rectangular notches of different widths, namely 1/2 inch and 3 inches. The discharge through the 1/2 inch notch is collected in a tank while the discharge from the 3 inch notch is permitted to escape. Thus a sample of the runoff and the groded material is obtained for every storm. For the larger tracts a rectangular notch, 6 inches in width is used in place of the 3 inch notch.

The purpose of the tests was the calibration of the notches so that the total runoff from the tract could be computed after the amount of the sample flow from the 1/2 inch notch was determined. In other words, it was necessary to determine the ratio of flow between the 1/2 inch and 3 inch notches. A constant ratio of flow was highly desirable.

The arms of a substitute of the section of the sect

The first fermion contests in the subscribed provides the state of section and the section of the subscribed at the state of sections and the subscribed at the subscribed at

The state of the restriction with a manufacture of the second of the sec

#### DESCRIPTION OF EXPERIMENTAL APPARATUS

The University of Iowa possesses in its hydreulic laboratory a steel orifice and weir tank, 4 feet wide by 10 feet long by 4 feet 8 inches deep. This tank furnishes the most economical means for calibrating the proposed notches. A plate in which the desired rectangular notches were cut was bolted to one end of the steel tank. The apparatus, as set up for testing, is shown in Plate A. This view shows the 1/2 inch and 3 inch rectangular notches. The plates having the 1/2 inch and 6 inch notches were similar to the other plates, the metal strip separating the smaller and the larger notch being two inches wide for all cases.

The depth of flow through the rectangular notches was measured by means of a hook gage. This gage was set in a stilling well attached to the side of the tank, see Plate B. A pipe connected the stilling well with the tank. The water from the large notch was measured in the laboratory weighing tanks while the water from the 1/2 inch notch was measured in a volumetric tank, 2 ft. 4 inches wide by 8 feet long by 2 feet deep. This tank had a capacity of 30 cubic feet and was equipped with staff gages for reading the depth of the water.

The plates experimented upon consisted of two kinds, galvanized iron, 0.078 inch thick (No. 14 gage), and brass, 3/16 inch thick. Three plates were made of galvanized-iron, one with 1/2 inch and 6 inch notches, two with 1/2 inch and 3 inch notches. The duplicate plate was made for the purpose of determining the effect of any small differences in construction upon the discharge. The lips of the notches were made square, the width of the lips being the thickness of the metal, namely 0.078 inch.

with the same of the same of the the second of the particle of the second of The state of the same of the s the south of the total and the contract A CONTRACTOR OF THE PROPERTY O the transfer of the second of the garage and a south the coate of the first garages are streaming water the first field. The second of th The state of the s

Two plates were made of brass, one with 1/2 inch and 3 inch notches, and one with 1/2 inch and 6 inch notches. The lips of the notches in the brass plates were made 1/32 inch wide.


An adjustable false floor was used in the orifice tank to measure the effect of bottom contraction on the discharge through the notches.

Through adjustable vertical walls the effect of side contraction upon the discharge was measured.

The channel used for the regular tests was 4.03 feet wide by 3.5 feet long by 4.5 feet deep.

#### METHOD OF CONDUCTING TESTS

In order to simulate field conditions it was necessary to measure the discharges through the 1/2 inch and the 3 inch rectangular notches simultaneously as well as separately. The tank used for collecting the water from the 1/2 inch notch was carefully calibrated by weighing the amounts of water required to change the vater level in the tank. The large laboratory weighing tank was used to measure the water from the 3-inch notch. The discharges from both notches were timed with stop watches to tenth seconds. The heads on the notches were measured by means of hook gage reading to 0.001 ft. Readings of the hook gage were recorded every 30 seconds during in experiment and the average of these used as the correct head on the notches. A test was made to determine the error caused by such a procedure. The discharge was measured under a fluctuating head. The hook gage readings were then averaged. Another test was then run at a steady head equal to the average head in the previous test. The discharge through the 3-inch notch was the same in each



case. The discharge through the 1/2 inch notch varied only 1 per cent.

Water entered the approach channel over a weir 3 feet in front of the notch plate, see Plate B. No attempt was made to smooth out the turbulence in the water by means of baffles since it is not expected to use baffles in field installations. For heads above 0.93 feet the weir became submerged and a series of standing waves was formed in the channel which may have affected the hook gage readings a little. However, some judgment was exercised in drawing the discharge curves as may be seen from an inspection of these curves.

All notches were tested at intervals of head of 0.01 foot for heads up to 0.10 feet; 0.05 feet for heads from 0.10 to 0.30 feet; and 0.10 foot for all heads over 0.30 foot. The maximum head run was 1.10 feet and the maximum discharge through two notches, 1.8 c.f.s.

The state of the state of the control of the state of the

Over 350 tests were made on the following sixteen different set-ups:

Width of	Kind of	Width of Approach Channel. Feet	Distance Floor	For
Notches,	Metal		below crests	data
Inches	Plate		of Notches	see Fig.
1/2, 3 1/2, 3 1/2, 3 1/2, 3	Galv. Iron (first plate) """	4.03 4.03 4.03 4.03	3.5 feet b inches l inch Level with crest	1 2 4 3
1/2, 3	97 99	2.23	Level with crest	5
1/2, 3	97 °9	<b>0.</b> 83	Level with crest	6
1/2, 3	Galv. Iron (duplicate plate) " " "	4.03	l inch	13
1/2, 3		4.03	Level with crest	14
1/2, 3		4.03	l inch	15
1/2, 3		4.03	2 feet	16
1/2, 6	Galv. Iron	4.03	l inch	<b>7</b>
1/2, 6		4.03	Level with crest	8
1/2, 3	Brass	4.03	l inch	9
1/2, 3	Brass	4.03	Level with creat	10
1/2, 6	Brass	4.03	l inch	11
1/2, 6	Brass	4.03	Level with crest	12

For low heads the duration of an experiment was usually 12 minutes.

As the head increased this time was gradually diminished to 3 minutes.

Sufficient water was run in each test to make the possible error in weighing and measuring negligible.

• 

#### RESULTS OF TESTS

The discharge curves obtained for the various notches are shown in figures 1 to 16 inclusive. It will be noted that the discharge curves for heads below 0.3 foot are drawn to an enlarged scale while the curves for discharges over 0.3 foot are given on a smaller scale. It will be noted that practically all the points in any figure lie on smooth curves. This in itself would indicate a minimum of experimental errors. The curves showing a ratio of flow through the large notch to the flow through the small notch are shown at the left in each of figures 1 to 16.

In order to compare the results of various tests, quantities for certain heads were read from the discharge curves and tabulated. These tabulated quantities were then compared by plotting the percentage variation of a given discharge from the standard condition which was taken to be the discharge of a brass notch with the floor of the approach channel one inch below the crest of the notches and the width of the approach channel 4.03 feet. Figure 17 shows the effect of the location of the floor of the approach channel upon the discharge under various noted conditions as compared to the discharge at the "standard condition."

Effect of Metal Strip Between Notches on Discharge

The space between the notches was 2 inches which was too small a distance to allow the notches to act independently of each other. The effect was to turn the jet from the 1/2 inch notch toward the larger notch. This caused the 1/2 inch jet to cling to the side of the notch as it passed through the opening while the jet sprang free from the

The State of Sweet Baker

Commence of the second section of the second section is

en de la composition La composition de la

Manager and the second of the s

in the contract of the particular to the particular of the contract of the con

ably by the small notch. The jet came out at right angles to the metal plate although the contraction on the side next to the 1/2 inch was not as great as it was on the side opposite.

An inspection of figures 1 to 16 shows that the ratio of discharges (large notch to small notch) is not constant. Without exception the ratio curves have similar shapes, the ratios increase above and below 0.10 to 0.15 foot head. However, certain ratios will be suggested for use at various heads.

#### Effect of Plate Material on Discharge

The reliability of galvanized iron as a material for notch plates was determined from this investigation. Since such plates cost about one sixth of the price of brass plates, this question was important. The discharges from the three galvanized iron plates were compared with that from the two brass plates in order to determine the differences if any existed. The brass notches were machined true and were accurately dimensioned. They were regarded as standard and as nearly perfect as would be secured. One of the galvanized iron plates was somewhat warped but the two others were quite true.

Inspection of the curves in figures 18 and 19 shows that there is little difference between the discharges through the 3-inch or 6-inch galvanized iron or brass rectangular notches. The variation is small, being not more than 1 or 2 per cent throughout practically the entire range of head. This amount of error can easily exist between two tests under identical conditions and can be attributed to the

State of the state

at and Estate and the

And the second of the second o

inability to measure all quantities to more than three figures and to the element of judgment which enters into the drawing-up of the discharge curves. Hydraulic experiments of this type generally check no closer than 1 per cent. Hence it is reasonable to say that the discharge through the large notches was the same whether brass or galvanized iron plates were used, even though the galvanized iron notches were not precisely true.

On the other hand, the 1/2 inch notches show greater discharge in the galvanized iron plates than in the brass plates. It is believed that this is due to the fact that the galvanized iron was thicker than the brass at the edge of the opening, the galvanized iron plate being 0.078 inch thick and the lip of the brass notch in the brass plate 0.040 inch thick. Since the jet came through the 1/2 inch notch at a considerable angle, the thicker metal caused the jet to cling to it more than to the thinner brass lip and so increased the effective area of discharge. This effect, while not large, was evident throughout the tests. If this conclusion is correct, it is important that all notches have two same thickness at the edge in order to give uniform performance.

Inasmuch as the depth of the channel of approach to the notches can not be made very great in field installations, the effect of the depth of the approach channel on the discharge through the notches was investigated quite fully. Tests were run on the same notches with the floor of the approach channel 3.5 feet, 2.0 feet 6 inches, and 1 inch below the crests of the notches and also with the floor level with the creat. Figure 20 shows the results of these tests while figure 17

exaggerates the differences in order that they may be more easily read. All variations are based on the discharge with the floor 1 inch below the crest. The curves show that for heads between zero and 0.80 foot there is very little difference between the discharges with floor 3.5 feet, 2.0 feet and 1 inch below the crest. There was a certain amount of turbulence at the entrance to the approach channel and this acted in different ways as the location of the floor was changed. It is believed that the standing waves set up in the channel of approach cauded the readings of head to be slightly different under each position of the floor and that the variation between the discharges at various floor levels is more a measure of the effect upon the hook gage piezameter of the currents in the channel than of actual change of discharge. It is believed that this condition affected the results of the tests with the floor 6 inches below the crest so that this set of tests vary a little from the others. Apparently the velocity of approach is so small that the jet gets its full vertical contraction even with the floor I inch below the crest. In all of the tests with the channel of approach 4 feet in width, the velocity of approach was negligible. It would be expected then that this width of channel could have any floor level greater than 1 inch from the crest and still deliver the same amount of water through the notches.

The effect upon discharge of the floor of the approach channel set level with the crest of the notches was investigated since this condition might be used in the field. This set-up gave less discharge for the low heads and greater discharge for the high heads than was obtained for the tests with the floor set below the level of the crest. This was

to be expected. As the water approached the notches the velocity was decreased at the bottom due to the friction of the floor and no vertical contraction existed at the low heads. Hence at low heads the effect of the floor level with the crest was to slow up the water and decrease the discharge. For higher heads, however, the effect of floor friction became negligible and the absence of vertical contraction of the under side of the jet caused the jet to have greater cross-sectional area and accordingly greater discharge. This increase in discharge grew less as the head increased since the area affected became a smaller and smaller portion of the total cross-sectional area of flow.

In the laboratory experiments, the heads on the slots were measured by a piezometer in the side of the approach channel 2 feet 8 inches in front of the notches for the standard tests. For those tests having different channel conditions the head was measured by a piezometer in the floor near the center of the channel and 12 inches in front of the notches. This variation in location is undoubtedly more extreme than the variations of piezometer locations in field set-ups would be, but the difference in discharge through a notch under otherwise identical conditions is only 2 per cent. Hence, it is felt that the point at which the head on the notches is measured is not of great importance although it is recommended that, if practical in field locations, the piezometer opening may well be placed on the side of the approach channel 2 feet 8 inches in front of the notches.

The precentage-variation curves generally show a large fluctuation at low heads. It is felt that it is not an indication of widely

varying results for the reason that it is impossible to read accurate values from the curves near the origin. Thus, one curve for the 1/2 inch notch may show a discharge of 0.0004 c.f.s. at 0.02 foot head and enother 0.0005 c.f.s. The percentage of variation of the second from the first is 25 per cent but actually it makes little difference since either quantity is too small to have much effect on the general result. Effect of Width of Channel of Approach on Discharge

Tests were made on the following widths of channel of approach, 4.03 feet, 2.23 feet, and 0.83 foot. It was found that, for the same head, reducing the width of the channel of approach increased the discharge through the notches. This is natural since the velocity head of the moving water becomes greater with the narrow channels. However, it is not believed that channels more than 4 feet in width will discharge less water than did the 4-foot channel, for the velocity of the water is so small that the maximum velocity head is only about 0.001 foot for that width. Wider channels would reduce this head still further and its effect would become too small to measure. In the 0.83 foot channel, however, the maximum velocity head was 0.027 feet, an appreciable amount which has considerable effect on the discharge.

### Hydraulic Formulas for Rectangular Notches

In a search through hydraulic literature it was found that

H. W. Maynard and J. P. Hurley \*ade a series of experiments in 1907on

the flow of water through narrow rectangular notches at the hydraulic

laboratory of Cornell University. See "The Corrail Civil Engineer,"

April 1912, pages 384-391. These experiments covered, weirs with crests

ranging from 3 inches to 51 inches long. The formulas derived by Maynard

and Hurley are as follows:

For high heads 
$$Q = 2/3 \times 0.571 1 \text{ h} \cdot \frac{0.045}{2 \text{ g h}}$$
 (1)

For low heads 
$$Q = 2/3 \times 0.553 \, l \, h$$
 0.963  $2 \, g \, h$  (2)

They stated that the "point of change from one law (formula) to another" was not fully apparent.

Naturally, formulas 1 and 2 are not strictly applicable to these experiments since these tests have two notches in the side of a metal box separated by a strip of metal only 2 inches wide.

Studies were made of the experimental data by plotting on logarithmic paper the recommended discharges for various heads as given under the chapter on "Recommendations." It was found that, with the exception of certain discharges for some of the lowest heads, the data followed the straight line law. The greatest variation was in the data for the 1/2 inch notch for heads under 0.06 foot. The following formulas were derived for the various notches:

For the 1/2 inch notch when used with either the 3-inch or 6-inch notch

$$Q = 3.46 \, lh^{1.46}$$
 (3)

For the 3-inch notch

$$Q = 3.24 1 h^{1.50}$$
 (4)

For the 6-inch notch

$$Q = 3.14 \cdot 1 \cdot h \cdot 1.47$$
 (5)

and the second of the second o

Formulas 3, 4, and 5 can be used only with weir boxes 4 feet wide and 3 feet long with the floor of the box at least 1 inch below the crests of the notches. Naturally a strip of metal 2 inches wide must separate the notches. While formula 3 is a general formula for the 1/2 inch notch, separate formulas for this slot may be derived for use with either the 3-inch or 6-inch notches.

A comparison of the discharges through the 1/2-nch, 3-inch, and 6-inch notches, as measured in the experiments, was made with discharges computed from Maynard and Hurley's formula No. 1. It was found that the Maynard and Hurley formulas gave discharges from 6 to 13 per cent less for the 3-inch and 6-inch notches than was obtained in the Iowa experiments. With the exception of a few low heads on the 3-inch notch, formula No. 2 gave discharges consistently under the discharges obtained in the Iowa tests.

#### RECOMMENDATIONS

- 1. Due to the great difference in cost between brass plates and galvanized-iron plates it is recommended that the notches be made in galvanized-iron sheets of No. 14 gage. This gage metal was used in the laboratory tests and should be used in all field installations.
- 2. It is recommended that all field boxes be made at least 4 feet wide and 3 feet long. Greater widths and lengths than these will not affect the discharge table recommended for use.
- 3. If the floor of a 4ft. by 3 ft. box is placed 1 inch (or more) below the crests of the notches, the following discharge table may be used for field work, the error in the laboratory tests for any particular notch being in general less than 2 per cent.

For 1/2-inch & 3-inch Notches			For 1/2-inch & 6-inch Notches			
Head on Notch Fost.	Discharge through 3-inch Notch C.F.S.	through	Ratio flow	Discharge through 6-inch Notch C.F.S.	through	Ratic flow
0.02	00037	0.0006	5.65	0.0055	0.0004	11.68
.04	.0085 .0139	.0015	5.50 5.38	•0144 •0254	•0012 •0023	11.41
.08	.0201	.0038	5.28	•025± •0388	.0034	11.10
10	.0272	.0052	5.25	.0538	.0049	11.02
.15 .20	.048 .073	.0092 .0139	5.23 5.22	.0985 .148	.0090 .0138	10.88
.25	.102	.0194	5.26	.206	.0191	10.78
.30	.134	.0253	5.30	268	.0248	10.79
•40 •50	.206 .238	.038	5.43 5.53	.412 .570	.038 .052	10.92
•60	.375	.067	5.58	•738	.052	11.00
.70	.469	.08/1	5.61	.924	.083	11.12
.80	.574	.102	5.64	1.122	.100	11.24
.90	.692	122	5.68 5.7/	1.350	.119	11:38
1,00	.813 .964	.143 .166	5.74 5.81	1.622	•140	11.60

and the second of the second o

the state of the s

4. If the exact head on the slots is not known, then the following ratios may be used:

Manager 1	Heads from zero to 0.4 ft.	Heads from 0.4 ft. to 0.8 ft.	Heads from 0.8 ft to 1.1 ft.
For 1/2-inch and 3-inch notches Ratio Q3 to Q1/2 notch	5.3	5•5	5.7
Ratio Q <sub>total</sub> to Q 1/2	6.3	6.5	6.7
For 1/2 and 6 inch notches			
Ratio Q <sub>6</sub> to Q <sub>1/2</sub>	10.9	11.1	11.5
Ratio Q <sub>total</sub> to Q <sub>1/2</sub>	11.9	12.1	12.5

The results obtained by the use of this table will not be more than 3 per cent in error except at heads under 0.04 ft. where the discharge is very small.

5. If it is necessary to make the floor of the discharge basin level with the crests of the notches in field installations, it is recommended that the curves on figures 10 and 12 be used to determine the discharges of various heads.

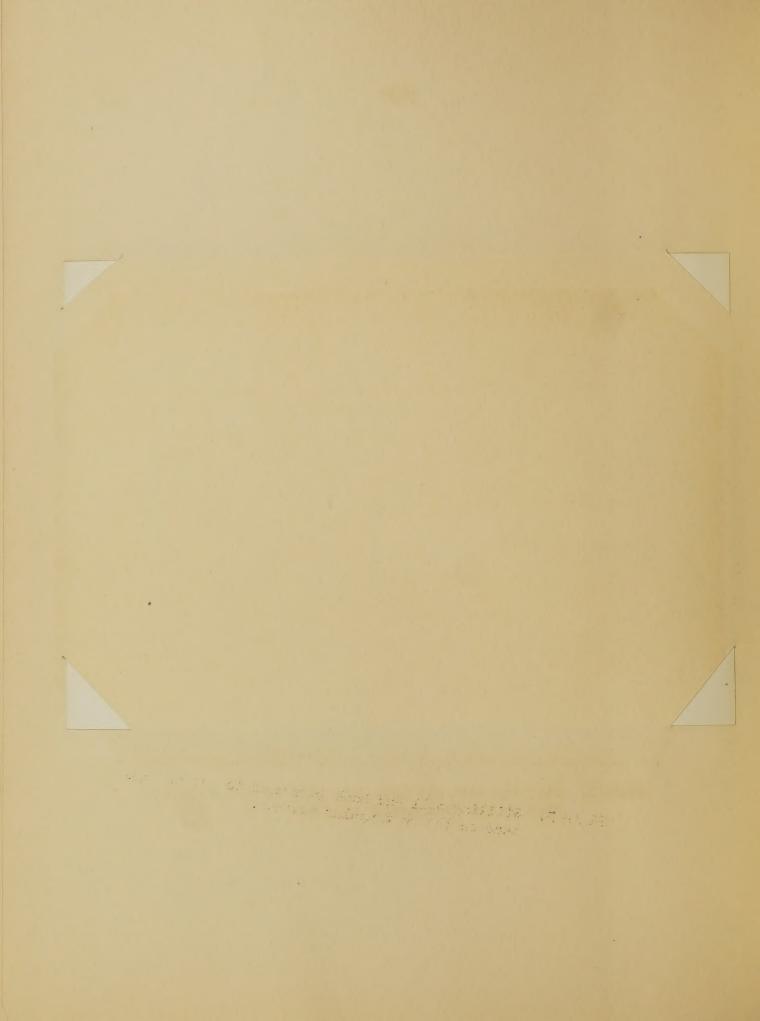


Plate A. A general view of apparatus used for calibrating the rectangular notches.

en de san jour la la troite de la company de



Plate B. Stilling well and hook gage used to get average head on the rectangular notches.



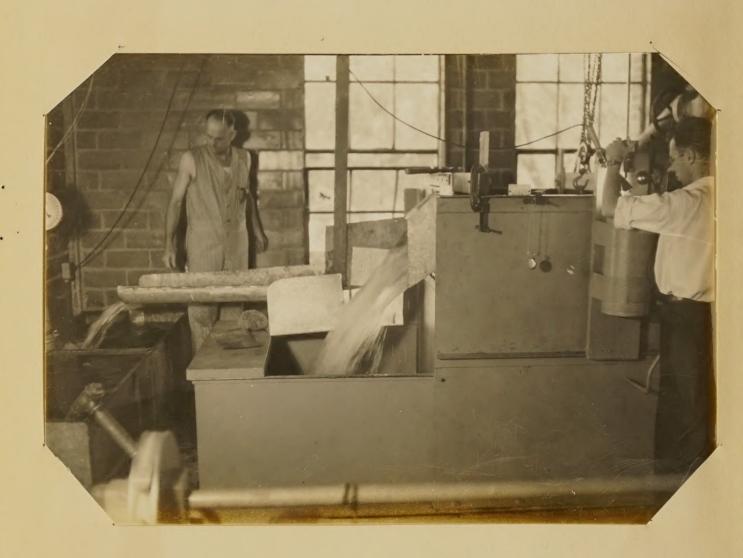


Plate C. Volumetric tank in left of view for measuring discharges through the 1/2-inch notch.

The state of the s